

Significant Incidents and Close Calls in Human Spaceflight

A Product of the JSC SMA Flight Safety Office

Legend

Loss of Crew	Crew Injury/Illness and/or Loss of Vehicle or Mission	Related or Recurring event
--------------	---	----------------------------

STS-110 4/8/2002
STS-109 3/1/2002
STS-108 12/5/2001
 Incorrect adjustments to the controller software resulted in SSME underperformance.
 Crew: 7

STS-91 6/2/1998
 Main engine pressure chamber sensor failed. If it occurred later, logic error may have triggered at RTL.
 Crew: 6

Soyuz TM-9 2/11/1990
 DM insulation torn loose on ascent; contingency EVA repair.
 Crew: 2

SRB Seal Events (1981-1996)
STS-51L (Challenger) 1/28/1986
SRB seal failure.
 Crew: 7
 Loss of Crew

Other SRB gas sealing anomalies: STS-2, 6, 41B, 41C, 41D, 51C, 51D, 51B, 51C, 51F, 51J, 51J, 61A, 61B, 61C, 42, 71, 70, 78

STS-61F 7/29/1985
 Temperature sensor problems resulted in SSME1 shutdown at T+5:45.
 Crew: 7
 Abort To Orbit

Soyuz 18-1 (18a) 4/5/1975
 Electrical fault caused premature firing of half of the 2nd stage separation bolts, resulting in the inability to fire the remaining ones. Staging failure resulted in abort sequence being used at T+295 seconds.
 Crew: 2
 Loss of Vehicle/Mission

Apollo 13 4/11/1970
 2nd stage center engine shutdown due to pogo oscillations.
 Crew: 3

Apollo 12 11/14/1969
 Lightning strike on ascent.
 Crew: 3

Gemini 10 7/18/1964
 1st stage oxidizer tank exploded at staging. No discernable effects. Nominal ascent.
 Crew: 2

STS-112 10/7/2002
 T-0 umbilical issues resulted in none of the system A pyrotechnic charges firing.
 Crew: 6

STS-61C 1/6/1986
 System configuration errors resulted in inadvertent drain back of 14,000 lbs of LOX prelaunch, which would have resulted in a Trans-Atlantic Abort Landing.
 Crew: 7

On-pad Abort Events (1984-1993)
STS-41D 6/26/1984
 Following a pad abort, LH₂ leaked from SSME3, resulting in a fire at the base of the orbiter.
 Crew: 6

Soyuz T-10-1 (T-10a) 9/24/1983
 Pad booster fire/explosion. Capsule Escape System used.
 Crew: 2
 Loss of Vehicle/Mission

Other On-pad Abort Events:
 STS-51F, STS-55, STS-51, STS-68.

STS-1 4/12/1981
 SRB ignition pressure wave caused TPS and structural damage.
 Crew: 2

Apollo 1 (AS-204) 1/27/1967
 Crew cabin fire (electrical short + high pressure O₂ atmosphere).
 Crew: 3
 Loss of Crew

Gemini 6 12/12/1965
 Main engine shutdown. Booster left unsecured on pad. Crew ejected not to eject. Launched 3 days later.
 Crew: 2

ISS Cargo Mission Failures (2011-2016)
Progress M-12M (44P) 8/24/2011
 Anomaly in fuel pressurization system led to shutdown of 3rd stage engine. Vehicle failed to reach orbit.
 Crew: 0
 Loss of Vehicle/Mission

Other ISS Cargo Mission Failures:
 Progress M-27M & MS-04, Cygnus CRS Orb-3, Dragon CRS SpX-7.

STS-117 6/8/2007
 Thermal blanket damage. EVA performed to repair damage.
 Crew: 7

STS-114 5/26/2005
 • Bird strike on External Tank.
 • Loss of foam from External Tank PAL ramp.
 • TPS gap fillers protruding. Removed during third mission EVA.
 • ET forward separation bolt NSI ejected causing damage to adjacent orbiter structure and TPS.
 Crew: 7

STS-93 7/23/1999
 • AT+5 a short on AC1 Phase A resulted in loss of SSME1 Controller A and SSME3 Controller B.
 • SSME3 H₂ leak: early LOX depletion and shutdown.
 Crew: 5

Ascent Debris 5/31/2008
STS-124
 3,500 refractory bricks blown away from flame trench wall during liftoff.
 Crew: 7

STS-95 10/29/1998
 Drag chute door separated during launch and impacted main engine bell.
 Crew: 7

Other significant ascent debris events have occurred on:
 STS-116 and STS-125

Late Release Orbiter Tyvek Covers
 STS-114, 115, 118, 119, 124, 126

EVA Incidents Summary (1965-2014)
 12 EVAs resulted in crew injury:
 Gemini 10, Apollo 17, Salyut 7 PE-1, Salyut 7 VE-3, STS-61-B EVAs 1&2, STS-37, Mir PE-9, STS-63, STS-97/4A, STS-100/6A EVAs 1&2, STS-134/ULF6
 Crew: 3
 Loss of Mission

Apollo 14 1/31/1971
 Multiple failed docking attempts. Contingency procedures developed to mitigate risk of recurring docking anomaly. Docking successful.
 Crew: 3

Apollo 13 4/13/1970
 Explosion due to electrical short. Loss of O₂ and EPS.
 Crew: 3
 Loss of Mission

See the Significant Incidents in EVA Operations Graphic and Interactive Version for more details. (spaceflight.nasa.gov/outreach/readersroom.html)

Apollo 10 5/22/1969
 Switch misconfiguration resulted in lunar module control problems.
 Crew: 2

Apollo 11 7/21/1969
 Engine arm circuit breaker knob broke off. Circuit breaker successfully reset allowing ascent.
 Crew: 2

STS-44 11/24/1991
 Failure of IMU 2 caused MDF to be declared. 10-day mission shortened to 7 days.
 Crew: 6
 Minimum Duration Flight

STS-99 2/2000
 High bacterial count in postflight sample after GIRA installed to remove iodine.
 Crew: 6

STS-95 10/29/1998
 Crew sickened in FGB; likely a result of high localized CO₂ levels due to poor ventilation.
 Crew: 7

STS-95 10/29/1998
 Preflight sterilization process chemically altered the Low Iodine Residual System resulting in contaminated drinking water.
 Crew: 7

STS-87 11/21/1997
 Spartan satellite deployed without proper activation. Recapture with RMS unsuccessful. Later captured by EVA crew.
 Crew: 6

STS-83 4/6/1997
 Failure of fuel cell number 2 resulted in MDF being declared. The 15-day mission was shortened to 3 days.
 Crew: 1
 Loss of Mission

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-44 11/24/1991
 Failure of IMU 2 caused MDF to be declared. 10-day mission shortened to 7 days.
 Crew: 6
 Minimum Duration Flight

STS-32 1/9/1990
 Erroneous state vector up-linked to flight control system, causing immediate and unpredictable attitude control problems.
 Crew: 5
 Loss of Attitude Control

STS-9 12/8/1983
 Two GPCs failed during reconfiguration for entry. One GPC could not be recovered.
 Crew: 6

STS-2 4/24/2001
 Failure of all U.S. command and control computers on ISS.
 Crew: 10

STS-99 2/2000
 High bacterial count in postflight sample after GIRA installed to remove iodine.
 Crew: 6

STS-95 10/29/1998
 Crew sickened in FGB; likely a result of high localized CO₂ levels due to poor ventilation.
 Crew: 7

STS-95 10/29/1998
 Preflight sterilization process chemically altered the Low Iodine Residual System resulting in contaminated drinking water.
 Crew: 7

STS-87 11/21/1997
 Spartan satellite deployed without proper activation. Recapture with RMS unsuccessful. Later captured by EVA crew.
 Crew: 6

STS-83 4/6/1997
 Failure of fuel cell number 2 resulted in MDF being declared. The 15-day mission was shortened to 3 days.
 Crew: 1
 Loss of Mission

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-44 11/24/1991
 Failure of IMU 2 caused MDF to be declared. 10-day mission shortened to 7 days.
 Crew: 6
 Minimum Duration Flight

STS-32 1/9/1990
 Erroneous state vector up-linked to flight control system, causing immediate and unpredictable attitude control problems.
 Crew: 5
 Loss of Attitude Control

STS-9 12/8/1983
 Two GPCs failed during reconfiguration for entry. One GPC could not be recovered.
 Crew: 6

STS-2 4/24/2001
 Failure of all U.S. command and control computers on ISS.
 Crew: 10

STS-99 2/2000
 High bacterial count in postflight sample after GIRA installed to remove iodine.
 Crew: 6

STS-95 10/29/1998
 Crew sickened in FGB; likely a result of high localized CO₂ levels due to poor ventilation.
 Crew: 7

STS-95 10/29/1998
 Preflight sterilization process chemically altered the Low Iodine Residual System resulting in contaminated drinking water.
 Crew: 7

STS-87 11/21/1997
 Spartan satellite deployed without proper activation. Recapture with RMS unsuccessful. Later captured by EVA crew.
 Crew: 6

STS-83 4/6/1997
 Failure of fuel cell number 2 resulted in MDF being declared. The 15-day mission was shortened to 3 days.
 Crew: 1
 Loss of Mission

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-44 11/24/1991
 Failure of IMU 2 caused MDF to be declared. 10-day mission shortened to 7 days.
 Crew: 6
 Minimum Duration Flight

STS-32 1/9/1990
 Erroneous state vector up-linked to flight control system, causing immediate and unpredictable attitude control problems.
 Crew: 5
 Loss of Attitude Control

STS-9 12/8/1983
 Two GPCs failed during reconfiguration for entry. One GPC could not be recovered.
 Crew: 6

STS-2 4/24/2001
 Failure of all U.S. command and control computers on ISS.
 Crew: 10

STS-99 2/2000
 High bacterial count in postflight sample after GIRA installed to remove iodine.
 Crew: 6

STS-95 10/29/1998
 Crew sickened in FGB; likely a result of high localized CO₂ levels due to poor ventilation.
 Crew: 7

STS-95 10/29/1998
 Preflight sterilization process chemically altered the Low Iodine Residual System resulting in contaminated drinking water.
 Crew: 7

STS-87 11/21/1997
 Spartan satellite deployed without proper activation. Recapture with RMS unsuccessful. Later captured by EVA crew.
 Crew: 6

STS-83 4/6/1997
 Failure of fuel cell number 2 resulted in MDF being declared. The 15-day mission was shortened to 3 days.
 Crew: 1
 Loss of Mission

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-51 9/12/1993
 Both port-side primary and secondary SUPER-ZIP explosive cords fired, resulting in containment tube failure and damage in the payload bay.
 Crew: 5

STS-44 11/24/1991
 Failure of IMU 2 caused MDF to be declared. 10-day mission shortened to 7 days.
 Crew: 6
 Minimum Duration Flight

STS-32 1/9/1990
 Erroneous state vector up-linked to flight control system, causing immediate and unpredictable attitude control problems.
 Crew: 5
 Loss of Attitude Control

STS-9 12/8/1983
 Two G